

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

CHILD SEATS:

Dorel Juvenile Group (DJG) is recalling certain Maxi-Cosi Mico infant child restraint systems, models 22-371 and 22-372, and Maxi-Cosi Mico infant child restraint system - base only, model 22-515, produced from July 2007 through February 17, 2008. Interference between the mounting bracket and the base caused by warping of the base or inadequate mating between the shell and the base mounting bracket can result in difficulty attaching or detaching the shell from the base. If the shell is improperly mounted to the base, the child could be injured in the event of a crash. DJG will notify all registered owners and will send a new Mico base to owners of the affected seats free of charge. The safety recall began on July 24, 2009. Owners may contact DJG at 1-877-657-9546.

09C-005

EQUIPMENT:

TRW Automotive is recalling 2,586 IGEN3 intermediate steering columns which were shipped to certain vehicle manufacturers between April 21 and May 26, 2009, for use as original and/or replacement equipment on heavy trucks. The weld around the IGEN3 steering shaft tube that secures the spline tube to the intermediate tube may be mislocated (i.e., not fully over the seam created when the tubes are pressed together.) Mislocated welds may result in torsional and axial strength falling below acceptable levels. This condition could result in separation of the steering column, loss of steering control and a vehicle crash without warning. Each vehicle manufacturer will provide a remedy plan and notification schedule. The affected vehicles will be repaired without charge to the owners. The recall began on July 2, 2009. Owners may contact their vehicle manufacturer or TRW Commercial Steering Systems at 1-765-429-1768.

09E-041

Trans/Air is recalling 3,962 EC Series air conditioning kits/relay boards sold to various vehicle manufacturers to be installed as original equipment on school and transit-type commercial buses. These units were also sold as aftermarket equipment. Each Trans/Air system comes with an electrical kit and EC PC board which if improperly installed could overheat. Overheating of the PC board could result in a fire. Each vehicle manufacturer will provide a remedy plan and notification schedule. The affected vehicles will be repaired without charge to the owners. Trans/Air will notify owners who purchased the subject air conditioning units as aftermarket and provide a free remedy. The recall is expected to begin during August 2009. Owners may contact their vehicle manufacturer or Trans/Air Warrant and Service Department at 1-800-673-2448.

09E-042

Import Products Company is recalling 30,351 fuel filters sold to and branded by the Affina Group as Carquest P/N 86523, NAPA P/N 3523, and WIX P/N 33523 for use as replacement equipment on the vehicles listed above. These filters may develop a leak in the hose assembly and/or connectors. This condition may result in a vehicle fire. The Affina Group will notify owners and the filters will be replaced free of charge. The safety recall is expected to begin during August 2009. Owners may contact WIX Filter Return Center at 1-704-869-7411 or Import Products at 1-508-279-8207.

09E-043

Chrysler is recalling 308 aftermarket Mopar tow bar assemblies, P/N 82209758, sold during 2007 and 2008

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

calendar year which are used to tow MY 2007 and 2008 Jeep Wrangler vehicles. The tow bar kit can fail under certain driving conditions. This can result in the towed vehicle to separate from the towing vehicle, possibly resulting in a crash. Chrysler will notify the owners of all 2007 and 2008 Model Year Jeep Wrangler vehicles who could have purchased a recalled tow bar and will replace the tow bars free of charge. The safety recall is expected to begin during August 2009. Owners may contact Chrysler at 1-800-853-1403.

09E-044

EBL Enterprises is recalling 800 motorcycle helmets, 500 series sizes XS, S, M, L, XL, 2XL, manufactured between April and May 2008. These helmets fail to conform to the impact attenuation requirements of Federal Motor Vehicle Safety Standard No. 218, "Motorcycle Helmets." In the event of a crash, the helmet wearer may become seriously injured without adequate protection. Dealerleather will offer a full refund or replace any noncompliant helmet with a helmet that meets Federal standards. The recall is expected to begin during August 2009. Owners may contact Dealerleather at 1-201-230-6353.

09E-045

Cummins is recalling 912 ISB CM2150, ISC CM2150, ISL CM2150, ISM CM876, and ISX CM871 model diesel engines installed as original equipment in various emergency vehicles. The vehicles may be designed with a hard wired, dash-mounted switch that enables the vehicle operator to inhibit aftertreatment diesel particulate filter regeneration in environments where the operator believes it may be unsafe for elevated exhaust temperatures. Due to an issue with the logic in the ECM software in these engines, the switch may not function correctly, leading the operator to believe that the switch is in "inhibit" mode when it is not. This condition will permit hot exhaust gases to exit the vehicle tailpipe, increasing the risk of melting or burning of nearby surfaces, or a fire. Each vehicle manufacturer will file a defect report and remedy plan for their vehicles which included these engines as original equipment. Vehicles will be repaired by Cummins at no cost to the owner. The safety recall is expected to begin during August 2009. Owners may contact either their vehicle manufacturer or Cummins at 1-800-DIESELS (1-800-343-7357).

09E-046

Airtex is recalling 1,440 aftermarket fuel pumps, P/N/n E3944M, produced from January 2005 through July 2009, sold for use on Model Year 1997 Saturn vehicles. The fuel return line and fuel vent line are reversed. In the event that a vehicle with the subject fuel pump is involved in a roll-over crash with a full or over-full fuel tank, the fuel could drain from the tank into the engine compartment, possibly resulting in a fire. Airtex will notify owners and replace the recalled fuel pumps with a pump that has been correctly manufactured free of charge. The safety recall is expected to begin during August 2009. Owners may contact Airtex at 1-618-842-2111.

09E-047

IMMI is recalling 83 side-roll airbags and seat belt pretensioners, labeled as Lot 0731, sold as originally installed equipment in various fire trucks and concrete mixers. The roll sensor designed to detect vehicle pitch and which controls the deployment of the pretensioners and the side-roll airbags can malfunction, resulting in an inadvertent deployment of the protection system. Inadvertent deployment of the side-roll protection system could result in a vehicle crash or injury to an out of position occupant. Each vehicle manufacturer will file a defect report and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

remedy plan for their vehicles which included these side-roll protection systems as original equipment. The vehicles will be repaired at no cost to the owner. The safety recall is expected to begin during August 2009. Owners may contact either their vehicle manufacturer or IMMI 1-317-896-9531.

09E-048

TIRES:

None during July 2009.

VEHICLES:

Volkswagen is recalling 18,500 MY 2009 Routan vehicles for failing to comply with the requirements of Federal Motor Vehicle Safety Standard No. 208, "Occupant Crash Protection." The owner's manual was printed without the FMVSS No. 208 required information explaining that no objects should be placed over the or near the air bag on the instrument panel. Any such objects could cause injury to the vehicle's occupants in the event of a crash severe enough to cause the air bag to inflate. Dealers will send an owner's manual insert containing the required air bag information for owner installation or dealers will install in the event the owner prefers assistance from the dealer. The recall began on July 31, 2009. Owners may contact Volkswagen at 1-800-822-8987.

09V-244

Gulf Stream is recalling 15 motorhomes equipped with axles that include Bosch ZOPS or ZOHT pin slide hydraulic disc brakes. When combined with occasional or seasonal vehicle operation may experience calipers sticking in the applied position. This can result in abnormal heat generation at the wheel end causing brake drag. The driver would normally detect the brake drag but if undetected the temperature increase at the wheel end can eventually lead to soft pedal conditions due to brake fluid boil, and possible extended stopping distance increasing the risk of a crash. Dealers will inspect and replace the necessary components free of charge. Workhorse is handling the remedy and owner notification for this campaign please see 09V-110. Owners may contact Workhorse at 1-877-246-7731.

09V-245

Triple E is recalling 16 motorhomes equipped with axles that include BOSCH ZOPS or ZOHT pin slide hydraulic disc brakes. When combined with occasional or seasonal vehicle operation may experience calipers sticking in the applied position. This can result in abnormal heat generation at the wheel end causing brake drag. The driver would normally detect the brake drag but if undetected the temperature increase at the wheel end can eventually lead to soft pedal conditions due to brake fluid boil, and possible extended stopping distance increasing the risk of a crash. Dealers will inspect and replace the necessary components free of charge. Workhorse is handling the remedy and owner notification for this campaign please see 09V-110. Owners may contact Workhorse at 1-877-246-7731.

09V-246

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

Hyundai Translead is recalling 572 converter dolly trailers manufactured for FedEx ground and equipped with certain Haldex quick release valves (QRV). The rubber diaphragm inside the QRV may experience delamination resulting in significant levels of air pressure leakage past and/or through the diaphragm, or the development of a bubble in the diaphragm which may trap air pressure in the valve and not allow the service brakes to release. Malfunction of the air brake system could result in a vehicle crash. Hyundai Translead is working with Haldex to notify owners. Haldex is handling the remedy for this campaign please see 09E-004. Haldex will repair the affected vehicles free of charge. The recall is expected to begin during August 2009. Owners can contact Haldex at 1-816-891-2470.

09V-247

Volkswagen is recalling 14,416 MY 2007-2009 Touareg vehicles. The fastening struts on the roof edge spoiler can crack, causing the spoiler to become loose and possibly detach from the vehicle without warning, even though initially the spoiler may feel secure. If this happens, the spoiler could cause injury by striking persons outside the vehicle or could become an obstacle to other drivers, possibly resulting in a crash. Dealers will install reinforcement wedges to the roof edge spoiler free of charge. The recall is expected to begin during August 2009. Owner may contact Volkswagen at 1-800-822-8987.

09V-248

J'S Mobility Unlimited, Inc., is recalling one Model Year 2005 Ford E-250 van equipped with a Ricon platform style wheelchair lift. This vehicle fails to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations in Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. J'S Mobility Unlimited is working with Ricon to correct the wheelchair lifts free of charge (please see 07E095). Owners may contact Ricon at 1-818-267-3000 or J'S Mobility Unlimited at 1-601-939-2112.

09V-249

J'S Mobility Unlimited, Inc., is recalling one Model Year 2005 Ford E-250 van equipped with a Ricon platform style wheelchair lift. This vehicle fails to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations in Motor Vehicles." The anti-stow interlock may not detect the presence of a wheelchair or mobility aid user. The pressure sensing switch that detects the presence of weight on the platform was not adjusted to the necessary sensitivity level. The lift could stow even though someone or something is still on the lift. The user of the lift could be injured should the lift move unintentionally. J'S Mobility Unlimited is working with Ricon to correct the wheelchair lifts free of charge (please see 07E097). Owners may contact Ricon at 1-818-267-3000 or J'S Mobility Unlimited at 1-601-939-2112.

09V-250

Blue Bird is recalling 69 Model Year 2008 through 2010 Micro Bird and Vision school buses manufactured from September 29, 2007 through May 2, 2009, equipped with optional 34 inch offset barrier. The offset leg of the barrier frame may have been located incorrectly and incorrect padding may have been installed on the 34 inch offset barriers which fails to comply with the leg protection zone requirements of Federal Motor Vehicle Safety Standard No. 222, "School Bus Passenger Seating and Crash Protection." Vehicle occupants may suffer

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

injuries in the event of a vehicle crash. Blue Bird will notify owners and replace the barrier pads with a new designed pad free of charge. The safety recall is expected to begin on or about August 12, 2009. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's recall campaign no. R09PJ.

09V-251

Elkhart Coach is recalling 5 MY 2008 and 2009 ECI and ECII commercial buses manufactured between September 26 and November 17, 2008, equipped with K410 air conditioning condenser assemblies supplied by Carrier. The K410 unit is installed on the top of the vehicle and its cover may not be properly fastened because of a mechanical interference. If the cover fasteners fail to securely fasten the cover in place, it may become detached during bus operation, possibly causing a crash or cause injury to pedestrians. Elkhart coach will notify owners and Carrier will provide a free retrofit repair kit to remedy the issue. The safety recall began on July 14, 2009. Owners may contact Carrier at 1-800-673-2431 or Elkhart Coach at 1-574-264-5179.

09V-252

Blue Bird is recalling 32 Model Year 2009 buses manufactured between July 3, 2008 through January 7, 2009 and sold to the U.S. General Services Administration for overseas use. These buses were equipped with defective Haldex quick release valves (QRV). The rubber diaphragm inside the QRV may experience delamination resulting in significant levels of air pressure leakage past and/or through the diaphragm, or the development of a bubble in the diaphragm which may trap air pressure in the valve and not allow the service brakes to release. Malfunction of the air brake system could result in a vehicle crash. Blue Bird will notify owners and repair the affected vehicles free of charge. The safety recall is expected to begin on or about August 13, 2009. Blue Bird's recall campaign no. R09PK. Owners can contact Blue Bird at 1-478-822-2242.

09V-253

BMW is recalling MY 2009 X5 and X6 vehicles. The rear brake discs may not have been manufactured according to specifications. As a result, a reduction in braking performance at the affected rear wheel could occur. In an extreme case, the affected rear brake disc could break resulting in a loss of braking at that wheel increasing stopping distances and the risk of a crash. BMW will notify owners and will repair the vehicles by inspecting the rear brake discs and, if necessary, replace them free of charge. The safety recall is expected to begin during August 2009. Owners may contact BMW Customer Relations and Services toll-free at 1-800-525-7417.

09V-255

BMW is recalling 1,535 MY 2007-2009 R1200RT motorcycles. Due to routing and assembly tolerances of the front brake lines, it is possible for the lines to be under strain. In combination with vibration during riding, the brake lines could develop a leak. The level of fluid in the front brake fluid reservoir could drop rendering the front brakes inoperative. In the event that only the rear brakes were operational, severe loss of control during hard braking could result. This could result in a serious crash. BMW will notify owners and repair the motorcycles with new front brake lines, with modified routing free of charge. The safety recall is expected to begin during August 2009. BMW's recall campaign no. R1200 RT. Owners may contact BMW at 1-800-831-1117.

09V-256

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

BMW is recalling 2,350 MY 2008 1-Series and 3- Series passenger cars. Incorrect crimp connectors may have been used on the side air bag and belt tensioner wiring. As a result sufficient contact between the crimp connectors and the corresponding plug may not occur which could lead to an increase in the electrical resistance of that connection. The side air bag and/or the safety belt tensioner may not deploy in a crash and an occupant may not be properly protected, increasing the risk of injuries or death. BMW will notify owners and repair the vehicles free of charge. The safety recall is expected to begin during August 2009. Owners may contact BMW Customer Relations and Services toll-free at 1-800-525-7417.

09V-257

Paccar is recalling 3,056 MY 2009 Kenworth and Peterbilt vehicles equipped with TRW steering shafts. Mislocation of a circumferential weld may allow the splined tube and non-splined tube to rotate relative to one another during a low speed, high torque turn, possibly resulting in a separation of the two tubes. A separation of the splined and non-splined tubes could cause a loss of steering control and increase the risk of a crash. Dealers will inspect the steering shaft using a weld placement gauge and miswelded steering shaft will be replaced free of charge. The recall is expected to begin during August 2009. Owners may contact Kenworth at 1-425-828-5440 and Peterbilt at 1-940-591-4196.

09V-258

Honda is recalling 440,000 Model Year 2001 and 2002 Civic, Accord, and Acura vehicles. The driver's airbag inflator could produce excessive internal pressure. If an affected airbag deploys, the increased internal pressure may cause the inflator to rupture. Metal fragments could pass through the air bag cushion material possibly causing injury to vehicle occupants. Dealers will replace the airbag inflator free of charge. Dealers will replace the airbag inflator free of charge. The safety recall is expected to begin during August 2009. Honda's recall campaign Nos. Q96 (Accord and Civic) and R13 (Acura). Owners may contact Honda Automobile Customer Service at 1-800-999-1009.

09V-259

Newmar is recalling 328 Model Year 2008 through 2010 recreational vehicles manufactured between April 16, 2007 and April 22, 2009. An inadvertent deviation in ground cable sizing occurred resulting in wire gauge undersizing. Undersized electrical conductors may result in conductor failure, creating a shock or fire hazard without warning. Newmar will notify owners and provide a free remedy. The safety recall is expected to begin during August 2009. Owners may contact Newmar at 1-574-773-7791.

09V-260

Land Rover is recalling 40 Model Year 2009 Range Rover vehicles. During the installation process it was identified that primer, applied by an automated glazing robot, was not being dispensed onto the glass. This omission can lead to the chemical bonding between the primer and the polyurethane adhesive not being activated and therefore the windshield not chemically bonded to the vehicle. Where the windshield is not chemically bonded, water could enter the vehicle and/or there may be increased wind noise. Full windshield retention may not be achieved in the event of an airbag deployment or during a vehicle crash. This increases the risk of injury in the event of a crash. Dealers will inspect the rear tailgate glass for the presence of primer and will prime the windshield glass as needed and free of charge. The recall began on July 17, 2009. Owners may contact Land

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

Rover at 1-800-637-6837.

09V-261

Lodal is recalling 19 MY 2008-2009 EVO trucks equipped with certain Haldex quick release valves (QRV). The rubber diaphragm inside the QRV may experience delamination resulting in significant levels of air pressure leakage past and/or through the diaphragm, or the development of a bubble in the diaphragm which may trap air pressure in the valve and not allow the service brakes to release. Malfunction of the air brake system could result in a vehicle crash. Lodal is working with Haldex to notify owners. Haldex is handling the remedy for this campaign please see 09E-004. Haldex will repair the affected vehicles free of charge. The recall began on July 15, 2009. Owners can contact Haldex at 1-816-891-2470.

09V-262

Universal Specialty is recalling 12 MY 2002-2006 Eagle class a motor homes equipped with axles that include BOSCH ZOPS or ZOHT pin slide hydraulic disc brakes. The calipers on these brakes may stick when the brakes are applied, which can result in abnormal heat generation at the wheel end causing brake drag. If the brake drag is left undetected, the temperature increase at the wheel end can eventually lead to soft pedal conditions and extended stopping distances, thereby increasing the risk of a crash. Dealers will inspect and replace the necessary components free of charge. Workhorse is handling the remedy and owner notification for this campaign please see 09V-110. Owners may contact Workhorse at 1-877-246-7731.

09V-263

Roadtrek is recalling 23 MY 2009 Class B motor homes built on Chevrolet 2500 van chassis. The propane distribution systems installed on these vehicles may contain a defective brass tee fitting that has too short of a thread such that, when connected to another fitting, the connection between the two fittings is not completely sealed. An unsealed connection could result in a propane leak, resulting in a possible fire hazard. Dealers will inspect and replace the defective brass tee connector fitting free of charge. The recall began on July 17, 2009. Owners may contact Roadtrek at 1-888-762-3873.

09V-264

Eldorado National - Kansas is recalling 4 MY 2004-2005 Aero Elite transit buses built between April 12, 2004 and September 18, 2006. Certain hydraulic brake lines may contact the transmission dipstick tube as the engine rocks. Continued contact between the brake line and the dipstick tube could abraid the brake line, cause a leak and loss of brake fluid, and reduce brake performance, potentially resulting in a crash without warning. Daimler Trucks is handling the owner notification and remedy for this campaign. Please see 09V-114. Daimler Trucks will correct the chassis if found to be defective. This service will be performed for you free of charge. Owners may contact Daimler Trucks at 1-800-547-0712.

09V-265

Glaval Bus is recalling 10 MY 2005 Concorde transit buses. The hydraulic brake lines may contact the transmission dipstick tube as the engine rocks. Continued contact between the brake line and the dipstick tube could abrade the brake line, causing a leak and loss of brake fluid which could lead to reduced brake performance. Reduced braking performance could result in a crash without warning. Daimler Trucks is handling

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

the owner notification and remedy for this campaign. Please see 09V-114. Daimler trucks will correct the chassis if found to be defective. This service will be performed for you free of charge. Owners may contact Daimler Trucks at 1-800-547-0712.

09V-266

Harley Davidson is recalling 1,759 MY 2009 FLTRSE3 motorcycles equipped with blade rear wheel accessory kits. Some wheels within the subject population underwent a secondary heat treatment process. As a result of this secondary heat treatment, these wheels may have a crack. If a crack is present, it could result in wheel failure during use, possibly leading to a crash, which could result in injury or death of the rider. Dealers will remove the rear wheel and inspect the manufacturer's code. Wheels that underwent a secondary heat treatment process will be replaced with a wheel provided in the recall repair kit. Wheels that do not have the suspected code will be re-installed. This service will be performed free of charge. The recall began on July 20, 2009. Owners may contact Harley Davidson at 1-414-343-4056.

09V-267

American River is recalling 1 MY 2006 GMC Savannah full size passenger vans equipped with a Ricon platform style wheelchair lift. The lift fails to comply with the requirements of Federal Motor Vehicle Safety Standard No. 403, "Platform Lift System Accessible for Motor Vehicles." The anti-stow interlock may not detect the presence of a wheelchair or mobility aid user. The pressure sensing switch that detects the presence of weight on the platform was not adjusted to the necessary sensitivity level. The lift could stow even though someone or something is still on the lift. A lift occupant can be injured should the lift begin to stow unintentionally. American river is working with Ricon to correct the wheelchair lift free of charge (Please see 07E097). Owners may contact Ricon at 1-818-267-300.

09V-268

American River is recalling 1 MY 2006 GMC Savannah full size passenger van equipped with a Ricon platform style wheelchair lift. The vehicle fails to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations on Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. American River is working with Ricon to correct the wheelchair lift free of charge (please see 07E095). Owners may contact Ricon at 1-818-267-3000.

09V-269

Main Mobility is recalling 185 Model Year 2005 through 2009 Chevrolet Express and GMC Savana vans manufactured between April 1, 2005 and June 25, 2009, equipped with Ricon platform style wheelchair lifts. These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations in Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. Main Mobility is working with Ricon to correct the wheelchair lifts free of charge (please see 07E095). Owners may contact Ricon at 1-818-267-3000 or Main Mobility at 1-716-759-6811.

09V-270

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

Freewheel Mobility is recalling 4 MY 2005 Ford E-350 and MY 2006 Ford E-250 passenger vans equipped with Ricon platform style wheelchair lifts. These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations on Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. Freewheel Mobility is working with Ricon to correct the wheelchair lifts free of charge (Please see 07E095). Owners may contact Ricon at 1-818-267-3000.

09V-271

Main Mobility is recalling 185 Model Year 2005 through 2009 Chevrolet Express and GMC Savana vans manufactured between April 1, 2005 and June 25, 2009, equipped with Ricon platform style wheelchair lifts. These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations in Motor Vehicles." The anti-stow interlock may not detect the presence of a wheelchair or mobility aid user. The pressure sensing switch that detects the presence of weight on the platform was not adjusted to the necessary sensitivity level. The lift could stow even though someone or something is still on the lift. The user of the lift could be injured should the lift move unintentionally. Main Mobility is working with Ricon to correct the wheelchair lifts free of charge (please see 07E097). Owners may contact Ricon at 1-818-267-3000 or Main Mobility at 1-716-759-6811.

09V-272

West Texas Rehabilitation Center is recalling 1 MY 2005 Chevrolet G3500 van and 1 MY 2006 Ford E-150 van equipped with Ricon platform style wheelchair lifts. These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 403, "Platform Lift Installations in Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. West Texas is working with Ricon to correct the wheelchair lifts free of charge (please see 07E095). Owners may contact Ricon at 1-818-267-3000 or West Texas at 1-325-793-3546.

09V-273

West Texas Rehabilitation Center is recalling 1 MY 2005 Chevrolet G3500 van and 1 MY 2006 Ford E-150 van equipped with Ricon platform style wheelchair lifts. These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 403, "Platform Lift Installations in Motor Vehicles." The anti-stow interlock may not detect the presence of a wheelchair or mobility aid user. The pressure sensing switch that detects the presence of weight on the platform was not adjusted to the necessary sensitivity level. The lift could stow even though someone or something is still on the lift. The user of the lift could be injured should the lift move unintentionally. West Texas is working with Ricon to correct the wheelchair lifts free of charge (please see 07E097). Owners may contact Ricon at 1-818-267-3000 or West Texas at 1-325-793-3546.

09V-274

Freewheel Mobility is recalling 4 MY 2005 Ford E-350 and MY 2006 Ford E-250 passenger vans and equipped with Ricon platform style wheelchair lifts. These lifts fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 403, "Platform Lift System Accessible for Motor Vehicles." The anti-stow

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

interlock may not detect the presence of a wheelchair or mobility aid user. The pressure sensing switch that detects the presence of weight on the platform was not adjusted to the necessary sensitivity level. The lift could stow even though someone or something is still on the lift. A lift occupant can be injured should the lift begin to stow unintentionally. Freewheel Mobility is working with Ricon to correct the wheelchair lifts free of charge (Please see 07E097). Owners may contact Ricon at 1-818-267-3000.

09V-275

Accessible Vans is recalling 1 Model Year 2006 Ford E-250 passenger van equipped with Ricon platform style wheelchair lift. The vehicle fails to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations on Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. Accessible Vans is working with Ricon to correct the wheelchair lift free of charge (Please see 07E095). Owners may contact Ricon at 1-818-267-3000.

09V-276

Subaru is recalling 15,633 MY 2005-2006 Baja vehicles. Cracks may develop in the fuel hose connection on the outlet pressure side of the fuel pump. Fuel can leak from the hose connection. A fuel leak, in the presence of an ignition source, could result in a fire. Dealers will replace the fuel pump bracket including all nipples with a new and stronger design part. This service will be performed free of charge. The recall is expected to begin during September 2009. Owners may contact Subaru at 1-800-782-2783.

09V-277

Tiffany Coachworks is recalling 26 MY 2008 E-450 Limo Bus and Shuttle Bus vehicles manufactured between March and November 2008, equipped with K410 air conditioning condenser assemblies supplied by Carrier. The K410 unit is installed on the top of the vehicle and its cover may not be properly fastened because of a mechanical interference. If the cover fasteners fail to securely fasten the cover in place, it may become detached during bus operation, possibly causing a crash or cause injury to pedestrians. Tiffany Coachworks will notify owners and Carrier will provide a free retrofit repair kit to remedy the issue. The safety recall began on July 29, 2009. Owners may contact Carrier at 1-800-673-2431 or Tiffany Coachworks at 1-800 338-5872.

09V-278

Showtime Conversions is recalling 3 MY 2001 and 2002 Showhauler motorhomes equipped with Norcold model 1200LRIM refrigerators, manufactured from March 1, 2001 to December 31, 2002, with serial numbers between 1273701 and 1536607, non-consecutively. A fatigue failure in the section of the cooling unit which contains the refrigerant could allow the liquid solution to slowly leak. If a leak occurs and the refrigerator continues to be operated after solution circulation has ceased the heat source could generate very high temperatures. At such high temperatures, the cooling unit could rupture. If a leak occurs and the unit is continues to operate, hydrogen gas may be expelled and can be ignited, resulting in a fire, possibly causing serious injury or death. Showtime will notify owners and the vehicle's refrigerator will be repaired free of charge. The safety recall began on August 3, 2009. Owners may contact Showtime Conversions at 1-574-825-1130 or Norcold's Recall Center at 1-800-767-9101.

09V-279

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

Hyundai is recalling 3,011 Model Year 2005-2007 Elantra, Tucson, Sonata, Azera and Accent vehicles. A malfunctioning stop lamp switch may cause the brake lights to not illuminate when the brake pedal is depressed or may cause the brake lights to remain illuminate when the brake pedal is released. A stop lamp switch may also affect the operation of the brake-transmission shift interlock feature so the transmission shifter would not be able to be shift out of the "park" position. It may also cause the electronic stability control (ESC) malfunction light to illuminate, and it may not deactivate the cruise control when the bake pedal is depressed. Any of these malfunctions could lead to a crash. Dealers will replace the stop lamp switch free of charge. The recall is expected to begin during August 2009. Owners may contact Hyundai of Puerto Rico Customer Service at 1-787-999-4310.

09V-280

Ride-Away is recalling certain vans equipped with Ricon platform style wheelchair lifts. These lifts fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 403, "Platform Lift System Accessible for Motor Vehicles." The anti-stow interlock may not detect the presence of a wheelchair or mobility aid user. The pressure sensing switch that detects the presence of weight on the platform was not adjusted to the necessary sensitivity level. The lift could stow even though someone or something is still on the lift. A lift occupant can be injured should the lift begin to stow unintentionally. Ride-Away is working with Ricon to correct the wheelchair lifts free of charge (Please see 07E097). Owners may contact Ricon at 1-818-267-3000.

09V-282

Ride-Away is recalling certain vans equipped with Ricon platform style wheelchair lifts. These lifts fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations on Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. Ride-Away is working with Ricon to correct the wheelchair lift free of charge (please see 07E095). Owners may contact Ricon at 1-818-267-3000.

09V-283

Blue Bird is recalling 9,117 Model Year 2008 through 2010 Vision school buses manufactured from March 27, 2007 through June 10, 2009. The lid gasket on the power steering reservoir may deteriorate and contaminate the power steering fluid which could result in a loss of power steering assist. Loss of power steering assist could result in a vehicle crash. Blue Bird will notify owners and repair the buses free of charge. The safety recall campaign is expected to begin on or about August 18, 2009. Blue Bird's recall campaign No. R09PH. Owners may contact Blue Bird at 1-478-822-2242.

09V-284

Blue Bird is recalling 1,709 Model Year 2009 and 2010 All American front engine school buses manufactured from February 27, 2007 through July 2, 2009, equipped with "07" engines, air brakes and spring suspensions. When the bus is loaded with passengers, the springs compress which could allow the air brake hose to contact the drive line. Repeated contact of the air brake hose on the drive line may cause the air brake hose to rupture reducing the braking capacity which could result in a vehicle crash. Blue Bird will notify owners and repair the buses free of charge. The safety recall is expected to begin on or about August 27, 2009. Blue Bird's recall

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

campaign No. R09PR. Owners may contact Blue Bird at 1-478-422-2242.

09V-285

Blue Bird is recalling 35 Model Year 2010 All American school buses manufactured from May 13 through June 17, 2009. Insufficient rivets were installed in the rear headliner panel. These buses fail to conform with the joint strength requirements of Federal Motor Vehicle Safety Standard No. 221, "School Bus Body Joint Strength." Bus passengers may sustain injuries in the event of a vehicle crash. Blue Bird will notify owners and repair the buses free of charge. The safety recall is expected to begin on or about August 25, 2009. Blue Bird's recall campaign No. R09PL. Owners may contact Blue Bird at 1-478-422-2242.

09V-286

Daimler Trucks is recalling 35 Model Year 2010 MVP-EF and HDX Thomas Built transit buses manufactured from October 22, 2008 through March 25, 2009 the emergency exit push-out window may be installed improperly resulting in binding of the window. In the event of an emergency evacuation, binding emergency exit windows may delay evacuation and may increase the risk of personal injury to the vehicle occupants. Daimler Trucks will notify owners and repair the buses free of charge. Repairs will be performed by Daimler Trucks dealerships. The safety recall is expected to begin on or about September 24, 2009. Owners may contact Daimler Trucks toll-free at 1-800-547-0712.

09V-287

Jayco is recalling 273 model year 2002-2004 Legacy fifth wheel motorhomes equipped with Norcold model 1200LRIM refrigerators, manufactured from March 1, 2001 to December 31, 2002, with serial numbers between 1273701 and 1536607, non-consecutively. A fatigue failure in the section of the cooling unit which contains the refrigerant could allow the liquid solution to slowly leak. If a leak occurs and the refrigerator continues to be operated after solution circulation has ceased the heat source could generate very high temperatures. At such high temperatures, the cooling unit could rupture. If a leak occurs and the unit is continues to operate, hydrogen gas may be expelled and can be ignited, resulting in a fire, possibly causing serious injury or death. Jayco will notify owners and the vehicle's refrigerator will be repaired free of charge. The safety recall is expected to begin during August 2009. Owners may contact Jayco at 1-800-283-8267 or Norcold's recall center at 1-800-767-9101.

09V-288

Coachmen is recalling 932 Model Year (MY) 1999-2003 Georgie Boy Cruise Master, MY 2000-2002 Maverick and Pursuit, MY 2000 & 2002 Cruise Air and MY 2001-2002 Suite motorhomes equipped with Norcold model 1200LRIM refrigerators, manufactured from March 1, 2001 to December 31, 2002, with serial numbers between 1273701 and 1536607, non-consecutively. A fatigue failure in the section of the cooling unit which contains the refrigerant could allow the liquid solution to slowly leak. If a leak occurs and the refrigerator continues to be operated after solution circulation has ceased the heat source could generate very high temperatures. At such high temperatures, the cooling unit could rupture. If a leak occurs and the unit is continues to operate, hydrogen gas may be expelled and can be ignited, resulting in a fire, possibly causing serious injury or death. Coachmen is working with Norcold and Norcold will notify owners and the vehicle's refrigerator will be repaired free of charge (Please see 09E-027). Owners may contact Norcold's recall center at 1-800-767-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

9101.

09V-289

Roush Performance Products, Inc. is recalling 81 Model Year 2010 Ford Mustangs manufactured between April 9, 2009, and July 15, 2009, and that were altered by Roush to include a sport brake kit option. The caliper anchor plate mounting bolts may become loose or dislodged during operation. This failure may result in a loss of stopping performance, possibly resulting in a vehicle crash. Roush will notify owners and repair the vehicles free of charge. The safety recall began on July 24, 2009. Owners may contact Roush at 1-866-307-6788.

09V-290

HME, Inc. is recalling 18 Model Year 2009 1871 fire trucks manufactured between January 21 and March 31, 2009. The steering angle sensor's (SAS) drive tab that was installed in the steering column assembly can break while driving. A broken SAS driving tab may result in unnecessary brake activation of a selected wheel during the ignition cycle in which the failure occurs, possibly resulting in a vehicle crash. HME, Inc. will notify owners and the vehicles will be repaired free of charge. The safety recall is expected to begin during August 2009. Owners may contact HME at 1-616-534-1463 or Meritor WABCO Vehicle Control Systems at 1-248-435-3605.

09V-291

Navistar is recalling 630 Model Year 2009 and 2010 IC school and commercial buses manufactured between February 1, 2008 and July 6, 2009, equipped with Trans/Air air conditioning systems. Each Trans/Air system comes with an electrical kit and EC PC board which if improperly installed could overheat. Overheating of the PC board could result in a fire. Navistar will notify owners and the vehicles will be repaired free of charge. Repairs will be performed by Trans/Air. The safety recall is expected to begin during August 2009. Owners may contact Trans/Air Warrant and Service Department at 1-800-673-2448 or Navistar toll-free at 1-800-448-7825.

09V-292

Navistar is recalling 3,449 IC school buses manufactured between March 1, 2008 and February 1, 2009, equipped with Specialty Manufacturing, Inc. (SMI) 000290 led light kits. A change to the wire used in the led light kits may reduce the effective life of the lights used on the stop arms. The lights may stop functioning without warning. Should the led lights stop functioning, visibility of a stopped bus would be decreased, possibly endangering a child or pedestrian to injury by passing vehicles. Navistar will notify owners and the buses will be repaired free of charge. Repairs will be performed by SMI. The safety recall is expected to begin on or about August 14, 2009. Owners may contact SMI Warranty Service at 1-800-951-7867 or Navistar toll-free at 1-800-448-7825.

09V-293

Changzhou Nanxiashu is recalling model year 2005-2007 trailers for failing to conform to the requirements of Federal Motor Vehicle Safety Standard No. 110, "Tire Selection and Rims" in that they are missing a tire placard label. Also, the GMWR on the certification label on some of the trailers is incorrect. Finally, the GVWR and GAWR must be stated in pounds. The missing and incorrect information could lead to improper vehicle loading

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

or tire inflation which could increase the risk of a crash. Central Purchasing is conducting the remedy for this campaign and corrected labels will be mailed to consumers with instructions to properly affix the corrected label to the trailer please see 09V-224. Owners may contact Central Purchasing at 1-805-388-1000.

09V-294

Access Mobility is recalling 3 Model Year 2004 Ford E250 and model year 2006 Dodge Sprinter vans equipped with Ricon platform style wheelchair lift. These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations on Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. Access Mobility is working with Ricon to correct the wheelchair lift free of charge (Please see 07E095). Owners may contact Ricon at 1-818-267-3000.

09V-295

Access Mobility is recalling 3 Model Year 2004 Ford E-250 and model year 2006 Dodge Sprinter vans equipped with Ricon platform style wheelchair lifts. These lifts fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 403, "Platform Lift System Accessible for Motor Vehicles." The anti-stow interlock may not detect the presence of a wheelchair or mobility aid user. The pressure sensing switch that detects the presence of weight on the platform was not adjusted to the necessary sensitivity level. The lift could stow even though someone or something is still on the lift. A lift occupant can be injured should the lift begin to stow unintentionally. Access Mobility is working with Ricon to correct the wheelchair lifts free of charge (Please see 07E097). Owners may contact Ricon at 1-818-267-3000.

09V-296

R&R Mobility is recalling 7 vans equipped with Ricon platform style wheelchair lift. These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations on Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. R&R Mobility is working with Ricon to correct the wheelchair lift free of charge (Please see 07E095). Owners may contact Ricon at 1-818-267-3000.

09V-297

R&R Mobility is recalling 7 vans equipped with Ricon platform style wheelchair lifts. These lifts fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 403, "Platform Lift System Accessible for Motor Vehicles." The anti-stow interlock may not detect the presence of a wheelchair or mobility aid user. The pressure sensing switch that detects the presence of weight on the platform was not adjusted to the necessary sensitivity level. The lift could stow even though someone or something is still on the lift. A lift occupant can be injured should the lift begin to stow unintentionally. R&R Mobility is working with Ricon to correct the wheelchair lifts free of charge (Please see 07E097). Owners may contact Ricon at 1-818-267-3000.

09V-298

Foretravel is recalling 1 Model Year 2002 U320 recreational vehicle equipped with a Norcold Model

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

1200LRIM refrigerator, manufactured from March 1, 2001 to December 31, 2002, with serial number between 1273701 and 1536607, non-consecutively. A fatigue failure in the section of the cooling unit which contains the refrigerant could allow the liquid solution to slowly leak. If a leak occurs and the refrigerator continues to be operated after solution circulation has ceased the heat source could generate very high temperatures. At such high temperatures, the cooling unit could rupture. If a leak occurs and the unit is continues to operate, hydrogen gas may be expelled and can be ignited, resulting in a fire, possibly causing serious injury or death. Foretravel is working with Norcold and Norcold will notify owners and the vehicle's refrigerator will be repaired free of charge (please see 09E-027). Owners may contact Norcold's Recall Center at 1-800-767-9101.

09V-299

Winnebago is recalling 1,547 Model Year 2001-2003 recreational vehicles equipped with Norcold model 1200LRIM refrigerators, manufactured from March 1, 2001 to December 31, 2002, with serial numbers between 1273701 and 1536607, non-consecutively. A fatigue failure in the section of the cooling unit which contains the refrigerant could allow the liquid solution to slowly leak. If a leak occurs and the refrigerator continues to be operated after solution circulation has ceased the heat source could generate very high temperatures. At such high temperatures, the cooling unit could rupture. If a leak occurs and the unit is continues to operate, hydrogen gas may be expelled and can be ignited, resulting in a fire, possibly causing serious injury or death. Winnebago is working with Norcold and Norcold will notify owners and the vehicle's refrigerator will be repaired free of charge (Please see 09E-027). Owners may contact Norcold's recall center at 1-800-767-9101.

09V-300

Drive Master is recalling 3 vans equipped with Ricon platform style wheelchair lifts. These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations on Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. Drive Master is working with Ricon to correct the wheelchair lift free of charge (Please see 07E095). Owners may contact Ricon at 1-818-267-3000.

09V-301

Drive Master is recalling 1 van equipped with a Ricon platform style wheelchair lift. The lift fails to comply with the requirements of Federal Motor Vehicle Safety Standard No. 403, "Platform Lift System Accessible for Motor Vehicles." The anti-stow interlock may not detect the presence of a wheelchair or mobility aid user. The pressure sensing switch that detects the presence of weight on the platform was not adjusted to the necessary sensitivity level. The lift could stow even though someone or something is still on the lift. A lift occupant can be injured should the lift begin to stow unintentionally. Drive Master is working with Ricon to correct the wheelchair lifts free of charge (Please see 07E097). Owners may contact Ricon at 1-818-267-3000.

09V-302

Van Products is recalling 8 vans equipped with Ricon platform style wheelchair lifts. The lift fails to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations on Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. Van Products is working with Ricon to correct the wheelchair lift free of charge (Please see 07E095). Owners may contact Ricon at 1-818-267-3000.

09V-303

Van Products is recalling 8 vans equipped with Ricon platform style wheelchair lifts. These lifts fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 403, "Platform Lift System Accessible for Motor Vehicles," the anti-stow interlock may not detect the presence of a wheelchair or mobility aid user. The pressure sensing switch that detects the presence of weight on the platform was not adjusted to the necessary sensitivity level. The lift could stow even though someone or something is still on the lift. A lift occupant can be injured should the lift begin to stow unintentionally. Van Products is working with Ricon to correct the wheelchair lifts free of charge (Please see 07E097). Owners may contact Ricon at 1-818-267-3000.

09V-304

Accessible Vans is recalling 1 van equipped with a Ricon platform style wheelchair lift. The vehicle fails to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations on Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. Accessible Vans is working with Ricon to correct the wheelchair lift free of charge (Please see 07E095). Owners may contact Ricon at 1-818-267-3000.

09V-305

Customizers is recalling 6 vans equipped with Ricon platform style wheelchair lifts. These lifts fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations on Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. Customizers is working with Ricon to correct the wheelchair lift free of charge (Please see 07E095). Owners may contact Ricon at 1-818-267-3000.

09V-306

Customizers is recalling 3 vans equipped with Ricon platform style wheelchair lifts. These lifts fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 403, "Platform Lift System Accessible for Motor Vehicles." The anti-stow interlock may not detect the presence of a wheelchair or mobility aid user. The pressure sensing switch that detects the presence of weight on the platform was not adjusted to the necessary sensitivity level. The lift could stow even though someone or something is still on the lift. A lift occupant can be injured should the lift begin to stow unintentionally. Customizers is working with Ricon to correct the wheelchair lifts free of charge (Please see 07E097). Owners may contact Ricon at 1-818-267-3000.

09V-307

Boulevard is recalling 3 vans equipped with Ricon platform style wheelchair lifts. These lifts fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 404, "Platform Lift Installations on Motor Vehicles." The threshold warning system may not detect the presence of a wheelchair or mobility aid user in a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

certain spot within the defined threshold area. The user of the lift could be injured should the lift move unintentionally. Boulevard is working with Ricon to correct the wheelchair lift free of charge (Please see 07E095). Owners may contact Ricon at 1-818-267-3000.

09V-308

GM is recalling 1,880 model year 2007 Chevrolet Kodiak and T-series, GMC Topkick and T-series, Isuzu F-series and H-series passenger vehicles equipped with 7.8l diesel engine. The air compressor in some of these vehicles may not build enough air pressure to support the air brake system. If this condition were to occur while the vehicles was stationary (brakes applied), the air brakes would remain applied and prevent the vehicle from moving. If the driver ignores these warnings and continues to drive the vehicle, and if there was a continued loss of pressure, the rear spring parking brakes would automatically apply, preventing the truck from being driven. Dealers will inspect the air compressor for its ability to build air pressure, and either modify the air compressor by elimination of the suppression valve or replace the air compressor assembly free of charge. The recall is expected to begin during August 2009. Owners may contact Chevrolet at 1-800-630-2438, GMC at 1-866-996-9463, Isuzu at 1-800-255-6727 or at www.gmownercenter.com.

09V-309

GM is recalling 185,903 model year 2004-2009 Colorado, GMC model year 2009-2004 Canyon, model year 2006 I-280, I-350, model year 2007-2008 I-290, and I-370, passenger vehicles originally sold in or currently registered in the states of Alabama, Arizona, Florida, Georgia, Hawaii, Louisiana, Mississippi, Nevada, New Mexico, Puerto Rico, South Carolina, Texas, U.S. Virgin Islands and Utah. Some of these vehicles have a brake lamp switch that may not work as designed due to contamination in the switch. This condition could cause the simultaneous loss of all brake lamps or cause all of the brake lamps to stay on continuously. Both of these conditions could fail to warn others of the driver's intentions and could lead to a vehicle crash. Dealers will inspect and replace the necessary components as specified in the recall bulletin free of charge. Gm anticipates that parts will be available by February 2010. A special coverage for vehicles registered in all other states will be implemented in the same time frame. In the interim, owners who experience the failure can obtain a free repair, however they will be required to return when the new design part becomes available. Owners may contact Chevrolet at 1-800-630-2438, GMC at 1-866-996-9463, Isuzu at 1-800-255-6727 or at www.gmownercenter.com.

09V-310

Keystone RV is recalling certain Model Year 2010 recreational vehicles manufactured from May 12 through June 19, 2009. The glass may not be properly adhered to the door in certain MiChef brand model EM925RZT microwave ovens. Only those vehicles with the following MiChef microwave serial number ranges (last 6 digits) are included in the recall: 000050-100, 000225-250, 000300-325, 000425-450, and 000460-500. The microwave is installed in an overhead cabinet. The glass could fall out and injure a nearby person. Keystone RV will notify owners and replace the microwave free of charge. The safety recall is expected to begin during August 2009. Owners may contact Keystone Customer Service at 1-866-425-4369.

09V-311

Fleetwood RV is recalling certain Model Year 2005 and 2006 motorhomes manufactured between July 24,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2009**

Published August 4, 2009

2004 and March 11, 2005, equipped with Norcold model 1200LR, 1200LRIM, and 1201LRIM refrigerators with serial numbers between 1273701 and 1536607, non-consecutively. A fatigue failure in the section of the cooling unit which contains the refrigerant could allow the liquid solution to slowly leak. If a leak occurs and the refrigerator continues to be operated after solution circulation has ceased the heat source could generate very high temperatures. At such high temperatures, the cooling unit could rupture. If a leak occurs and the unit is continues to operate, hydrogen gas may be expelled and can be ignited, resulting in a fire, possibly causing serious injury or death. Fleetwood RV will notify owners and the vehicle's refrigerator will be repaired free of charge. The safety recall is expected to begin during August 2009. Owners may contact Fleetwood RV at 1-800-509-3418 or Norcold's Recall Center at 1-800-767-9101.

09V-312

Champion Bus is recalling 36 model year 2004, 2005, and 2007 Defender and model year 2005-2006 M1000 buses built between April 12, 2004 and September 18, 2006. Certain hydraulic brake lines may contact the transmission dipstick tube as the engine rocks. Continued contact between the brake line and the dipstick tube could cause a brake fluid leak and reduce brake performance, potentially resulting in a crash without warning. Daimler Trucks handling the owner notification and remedy for this campaign. Please see 09V-114. Daimler Trucks will correct the chassis if found to be defective. This service will be performed for you free of charge. Owners may contact Daimler Trucks at 1-800-547-0712.

09V-313